

# **AQM**OPERATION MANUAL

PLEASE READ THIS MANUAL VERY CAREFULLY BEFORE OPERATING

#### **CONTENTS**

#### CAUTIONS

- 1. INSTALLATION
- 2. SPECIFICATIONS
- 3. KEYBOARD LAYOUT AND DESCRIPTION
- 4. INITIAL SETUP
- 5. INSTRUCTION FOR USE
- 6. TROUBLE SHOOTING
- 7. DAILY CARE AND MAINTENANCE

#### CAUTIONS

- 1. This unit is legal for trade only when it is sealed (and/or stamped) and bearing a serial number. Do not attempt to break the seal (or stamp) affixed to this scale or remove the serial number. Contact your dealer for more information and after sales service.
- For most accurate weighing result, do not use this scale in where or when the environment condition falls beyond as those listed on SPECIFICATIONS.
- Do not attempt to open this unit or conduct any trouble shootings other than those listed on TROUBLE SHOOTING.
- 4. Do not use this scale for chemical substances or in any environment that contains chemical vapor.
- 5. Do not submerge scale into water.
- 6. Do not use pressurized water nozzle for cleaning.
- 7. Precision measuring instrument, handle with care.

#### 1. INSTALLATION

1.1 Check and make sure that the following accessories are included:

Operation Manual x 1

Scale x 1

Plastic platter x 1

Stainless steel cover x 1 (Optional)

Power adaptor x 1

Contact your dealer if any item is missing.

1.2 Place the stainless steel platter (if purchased) onto the plastic platter.

#### 1.3 Power on the scale

- a. Before charging the scale or power on with the adaptor supplied. Please make sure the input voltage listed on the back of the adaptor matches with the local voltage. If not, do not use it and contact your dealer immediately.
- b. Before first time use, charge the scale for at least 8 hours to ensure the best performance.

#### 2. SPECIFICATIONS

Model No.	Capacity Division (e)		
	(Max)	OIML	Extended
AQM-1500	1500g	0.5g	0.05g
AQM-3000	3000g	1g	0.1g
AQM-6000	6000g	2g	0.2g
Tare Range	Full Tare Range		
Power-on	±10% Max		
Zero Range	TIUS Max		
Zero Range	±2% Max		
Min. Load	20e		
Power	By Built-in Rechargeable Battery or AD/DC		
Source	Power Adaptor		
Operating	0°~40°C (32°~104°F),		
Environment	Non-condensed	d. R.H.≦ 85%	

Specifications subject to change without notice


#### NOTE 1:

To comply with the law of certain countries and certain approval requirements, the avoirdupois weight units may be disabled. Contact your dealer for more information.

#### NOTE 2:

Extended display function does not support avoirdupois weight units (lb/lb and lb/oz).

#### 3. KEYBOARD LAYOUT AND DESCRIPTION

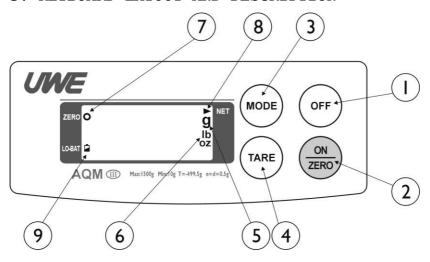

#### 1. OFF KEY

Press this key to turn scale off

#### 2. ON/ZERO KEY

Press this key to turn scale on or set weight to zero

#### 3. MODE KEY

Press this key to shift among different weight units and/or turn backlight on/off

#### 4. TARE KEY

Press this key to tare off the weight of a container.

#### METRIC UNIT INDICATOR

This indicator appears to indicate the weighing unit currently engaged is in metric (gram)

#### 6. AVOIRDUPOIS UNIT INDICATOR

This indicator appears to indicate the weight unit currently engaged is in avoirdupois (pound/ounce, e.g. 2.15.1 means 2 lb and 15.1 ounce).

#### 7. ZERO INDICATOR

This indicator appears to indicate a zero weight status

#### 8. NET INDICATOR

This indicator appears to indicate the tare function is in operation and weight displayed is net weight

#### 9. LO-BAT INDICATOR

When this indicator appears, recharge the scale immediately. Failure to do so may cause unrecoverable damage to the rechargeable battery inside scale

#### 4. INITIAL SETUP

#### 4.1 PLACING THE SCALE

In order to obtain an accurate weighing result, the scale must be placed on a strong and level surface.

If required, adjust the adjustable feet underneath scale to obtain a level position. Refer to the bubble indicator for leveling condition.

#### 4.2 INTERNAL SETTING

#### 4.2.1 Display Segment Check

User can enter this function to check to see if the display and backlight (if purchased) are functioning properly.

- a. Scale is off
- b. Press and hold TARE, then press ON/ZERO
- c. Scale displays F.1
- d. Press TARE once
- e. Scale displays F.2
- f. Press MODE and all segments will light up to allow user to check the condition of display
- g. Press TARE for next function setup or ON/ZERO to restart the scale

#### 4.2.2 Select Auto Power Off Setting

The scale is equipped with **Auto Power Off Function**. The scale will power off automatically if it is not used for 4 minutes. Follow the below steps to enable/disable **Auto Power Off Function**.

- a. Scale is off
- b. Press and hold TARE, then press ON/ZERO
- c. Scale displays F.1
- d. Press TARE three times
- e. Scale displays F.4
- f. Press MODE to shift between 0.\_OFF and 4.\_OFF
   -To enable Auto Power Off Function, press TARE when
   4. OFF appears
  - -To disable  ${\bf Auto\ Power\ Off\ Function}$  , press  ${\bf TARE\ }$  when  ${\bf 0.\ OFF\ } {\bf appears}$
- g. Press ON/ZERO to restart the scale or TARE for next function setup

#### 4.2.3 Select Auto Tare Function

This scale is equipped with auto tare function which tares off the initial weight automatically when this function is engaged. The tare weight is automatically cleared when everything is removed from platter.

- a. Scale is off
- b. Press and hold TARE, then press ON/ZERO

- c. Scale displays F.1
- d. Press TARE six times
- e. Scale displays F.9
- f. Press MODE to select between "Tr\_on" or "TroFF"
   -To enable Auto Tare Function, press TARE when Tr\_on
   appears
  - -To disable  $\mbox{\bf Auto\,Tare\,Function,}$  press  $\mbox{\bf TARE}$  when  $\mbox{\bf Troff}$  appears

#### 5. INSTRUCTION FOR USE

#### 5.1 BEFORE WEIGHING

Make sure that:

- a. The plastic platter is inserted firmly and the stainless steel platter cover is placed on the plastic platter.
- b. The scale is placed on a level and strong surface.
- c. The scale is turned on.
- d. The ZERO INDICATOR is on. If not, press ON/ZERO to set display to zero.

#### 5.2 WEIGHING

- a. Always place an object onto the platter gently. Excessive force applied to platter may cause damages to sensor inside scale.
- b. The weight of the object would be displayed automatically.
- c. It is a good practice to remove all loads from platter after weighing. It would prolong the lifetime of scale.

#### 5.3 SELECT WEIGHT UNIT

Press MODE to shift between metric or avoirdupois weight units. The weight unit used before power off would be employed when the scale is turned on again.

#### NOTE:

To comply with the law of certain countries and certain approval requirements, the avoirdupois weight units may be disabled. Contact your dealer for more information.

#### 5.4 SMART POWER SAVING FUNCTION

When this function enable, the backlight will turn off when constant/zero weight is detected and remains stable for about 20/10 seconds.

Backlight will be automatically turned on again when a new weight is detected.

#### 5.5 SET DISPLAYED VALUE TO ZERO WHEN UNLOADED

By pressing **ON/ZERO**, a positive or negative weight displayed will be set to zero and **ZERO INDICATOR** appears.

Refer to SPECIFICATIONS for maximum zero range.

#### NOTE:

-User only needs to press **ON/ZERO** once when setting the value to zero. The re-zero command will be memorized and take place when reading is stabled

#### 5.6 TARE OFF THE WEIGHT OF A CONTAINER

When a container is used, follow the below steps to manually tare off the weight of container and get the net weight.

- a. Remove all loads away from platter
- b. Make sure that the ZERO INDICATOR is on
- c. Place the container on the platter
- d. Press TARE

After TARE is pressed, the NET INDICATOR would appear.

Refer to **5.2** for weighing procedures. Weight displayed under is the net weight of the subject matter. Refer to **SPECIFICATIONS** for maximum tare range.

#### NOTE:

-User only needs to press  ${\bf TARE}$  once when tare off a weight. The tare command will be memorized and take place when reading is stabled

#### 5.7 CLEAR THE TARE FUNCTION

- a. Remove all loads from platter
- b. The tare effect will be cancelled:
  - -Automatically if automatic tare function is employed, or
  - -By pressing **TARE**
- c. After TARE is pressed, the NET INDICATOR would disappear.

#### 5.8 EXTENDED DISPLAY

This scale is equipped with extended display function for reference purpose only. To activate the function, press and hold MODE for 2 seconds and display will flash the extended digit for 5 seconds before return to normal.

#### 5.9 RECHARGE THE SCALE

The scale is equipped with a built-in rechargeable battery. When the **LO-BAT INDICATOR** appears, recharge the scale immediately. Failure to do so may cause unrecoverable damage to the rechargeable battery.

#### 6. TROUBLE SHOOTING

Syndrome Scale cannot be turned on

Check: Is the scale charged?

Action: Recharge the scale for at least 8 hours

before first time use or plug in the power

adaptor before power on the scale.

**Check** Is the power adaptor inserted properly into

both the electricity outlet and the DC inlet

of scale.

Action: Secure both ends of the power adaptor and

try again.

Syndrome Scale turned off automatically

Check Is Auto Power Off Function employed?

Action Refer to 4.2.2 to disable Auto Power Off

Function.

Check Is the LO-BAT INDICATOR on?

Action Apply the power adaptor.

Syndrome Rated capacity cannot be reached

Check Is the NET INDICATOR on?

Action: Turn the scale off. Remove all loads from

platter and turn on again.

**Check** Is there anything obstructing the platter?

Action Remove all obstacles.

Syndrome Weighing result is not accurate

**Check** Is the scale placed in a level condition?

Action Adjust the adjustable feet to a level

condition.

**Check** Is the scale affected by airflow, vibration

or RFI?

Action: Place the scale away from all disturbances.

**Check** Is the scale calibrated correctly?

Action Contact your dealer.

**Check** Is the correct weight unit employed?

Action Refer to 5.3 for weight unit setting and

usage.

Syndrome Display shows 00000 after counting down

**Check** Is the load applied to platter excess the

rated capacity of scale?

Action Remove all loads from platter and try again.

#### 7. DAILY CARE AND MAINTENANCE

- 7.1 Clean the scale with a soft and damp cloth. If necessary, apply a mild detergent.
- 7.2 Do not use any harsh, abrasive material, acetone, volatile solvent, thinner or alcohol for cleaning.
- 7.3 Verify the accuracy of scale periodically.

  Re-calibrate the scale if necessary.

NOTE: In some countries, calibration requires authorized/qualified agent. Contact your dealer for more information.

- 7.4 The scale must be placed horizontally during transportation or long time storage.
- 7.5 Remove platter from scale before transportation or long time storage.
- 7.6 Store scale in a dry and clean place.

# ( (

### KONFORMITÄTSERKLÄRUNG

## Declaration of conformity Déclaration de conformité

Die ichtselbsttätigen Waage



The non-automatic weighing instrument

L'instrument de pesage à fonctionnement non automatique

Hersteller:	Universal Weight
Manufacturer:	Enterprise
Fabricant	Co., Ltd.
Typ/Modell:	
Type/Model:	AQM
Type/modèle:	
Nr. der EG-Bauartzulassung (gegebenen falls):	T6160
No of the EC type-approval certificate (where applicable):	
N° du certificat d'approbation CE de type (le cas écheant):	

entspricht dem in der Bescheinigung über die Bauartzulassung beschriebenen Baumuster, sowie den Anforderungen der EG-Richtlinie 90/384/EWG in der jeweils geltenden Fassung und den Anforderungen folgender EG-Richtlinien:

corresponds to the production model described in the EC type-approval certificate and to the requirements of the Council Directive 90/384/EEC as amended and to the requirements of the following EC directives:

correspond au modèle décrit dans le certificat d'approbation CE de type, aux exigences de la directive 90/384/CEE modifiée et aux exigences des directives CE suivantes:

- \*Diese Erklärung gilt nur in Verbindung mit einer Konformitätsbescheinigung einer benanten Stelle.
- \*This Declaration of conformity is only valid with a certificate of conformity issued by a notified body
- \*Cette dèclaration est valide seulement avac une aattestation de conformitè d'un organisme notlflè.

Anmerkung 1: Der mit \* gekennzeichnete Satz entfäilt, wenn die nichtselbsttätige Waage vom Hersteller geeicht wurde.

Note 1: The sentence marked with \* does not apply, if the non-automatic weighing instrument was verified by the manufacturer.

Note 1: La phrasa marquie avac \* ne s'applique pas au cas où linstrument de passage à fonctionnement non automatique a éié vàifié par ie fabricant.

Unterschrift Signature Signature

12 1

Datum
Date
Date

Apr. >3, >003